MARCONIPHONE

895

H.M.V. 1406

Five-valve, two-waveband, superhet portable receiver for battery operation, using two-volt valves. Made by the Marconiphone Co., Ltd., and the Gramophone Co., Ltd., Hayes, Middlesex.

Circuit.—The frame aerial forms the medium-wave tuning-coil and is loaded by iron-cored L2 for long waves.

GRN

V1 is the frequency-changer and the Marconiphone battery, No. B496. The oscillator section is tuned grid with H.T. consumption is 9 ma. normally, reaction feed-back for the anode via L3 or 6 ma. in the economy position, and on M.W. and via C8 on L.W.

Iron-cored I.F. transformers link up V2, the I.F. amplifier, and V3, the double-diode triode.

The volume control, VR1, is also the signal diode load, C12 isolates the triode grid for the steady "carrier" voltage and R6 is an I.F. filter.

R10 and R11 form the A.V.C. diode load, delay bias being obtained from a bias network via R13.

V4 and V5 are output tetrodes in pushpull. They are energised through a parallel-fed push-pull input transformer, and drive the loudspeaker through a push-pull output transformer with tone condenser across the anode loads.

R14, 15 and 16 being between the filaments (chassis) and H.T. negative provide negative points for bias purposes.

The H.T. consumption can be reduced by an economy switch which connects R8 into the H.T. lead to V1 and V2.

C9

This is a portable two-waveband set, the medium-wave aerial grid coil forming the frame winding. Auto

bias, push-pull output and iron-core coils are other features.

PC3 L.T. accumulator and a 108-v. adjusted.

ECON.SWITCH

the H.T. .8 amp.

Extension Speaker.—This should have an impedance of 5 ohms.


GANGING

Having removed the chassis from the cabinet and the back of the cabinet with frame, reassemble the chassis, batteries and frame in exactly their correct relative positions. The H.T. voltage should not be less than 100 v. on load.

Keep the oscillator input low and reduce it as the circuits come into line so that the A.V.C. does not operate.

I.F. Circuits.—Remove small metal screen just above connections to I.F.2. Switch to M.W. minimum capacity, and turn economy switch to maximum.

Inject 465 kc, to VI grid via .1 mfd. and adjust the I.F. trimmers for maximum. A damping circuit consisting of .1 mfd. in series with 35,000 ohms can be connected across the opposite winding of Batteries.—These should be an Exide each transformer as each trimmer is

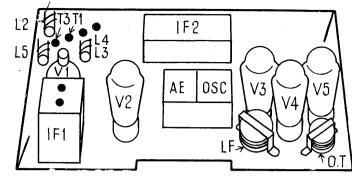

This set is a compact model and the chassis a little unusual. Two trimmers and the adjustable coil cores are located as shown. Two others are on the aerial frame.

M.W. Band.—Inject simply by leaving oscillator lead near the frame aerial or by connecting to aerial socket through not more than 5 mmfd. See that pointer registers on mark with gang at maximum.

Tune to 200 m., inject 1,500 kc. and adjust T1. Tune to 225 m., inject 1,333 kc. and adjust T2.

Tune to 520 m., inject 576.9 kc. and pad with core of L4, rocking gang CONDENSERS slightly.

Repeat these operations.

L.W. Band.—Tune to 900 m., inject 333.3 kc., and adjust T3. Tune to 1,350 m., inject 222.2 kc., and adjust

Tune to 1,900 m., inject 157.9 kc., and adjust cores of L2 and L5.

Repeat these operations.

Replace set in cabinet and check adjustment of T2 and T4. These are on the frame, T4 being below the E.

VALVE READINGS

1.	$Typ_{\ell'}$	Electrode	Volts	M_{i}
1	X24	Anode	100	.8
		Screen	60	1.
		Osc, anode	67	1
		Bias	1.5	
2	Z21	Anode	100	1.9
		Screen	100	.8
		Bias	.17	
3	HD24	Anode	57	
4	KT2	Anode	98	
		Screen	100	.:
		Bias	4.5	
5	KT2	Anode	98	.7
		Screen	100	.:
		Bias	4.5	
Fota	al current	at H.T. + 9 ma		

WINDINGS

L		Ohms.		Ohms.
6 7 8	2,750 + 225 +	200 - 2,750 - 225	9 10	 .2

R	Ohms.	R	.0) [
1	 23,000	10	2.3	1
•)	1 22200	11	9=	

1	 23,000	10	 2.3 meg.
2	 .1 meg.	11	 .35 meg.
3	 23,000	12	 .23 meg.
5	 2.3 meg.	13	 2.3 meg.
6	 .1 meg.	14	 150
7	 2.3 meg.	15	 300
8	 10,000	16	 450
9	 .1 meg.	VR1	 .5 meg.

RESISTANCES

C	Mfds.	C		Mfds
1	 15 mmfds.	10		.0001
2	 .1	12		,05
:3	 8	13		.1
4	 .1	14		75 mmfds.
5	 75 mmfds.	15		.05
6	 .0005	16		.001
7	 75 mmfds.	17		.001
8	 .0004	18-21	٠.	150 mmfds.
9	 .1	22		5 mmfds.

Testing Mains Cord

RESISTOR cords can often be repaired by joining and soldering the broken ends, which are found without stripping the whole insulation by means of an ohmmeter, or other current source, and very sharp test prods which will penetrate through the insulation to the element

Where the cord is badly destroyed it may be possible to replace it by a suitable resistor or even a barretter formed by putting an ordinary electric lamp (or lamps) in series with the set leads. It is easy to find when the correct set voltage is obtained by testing at the set input with an A.C. voltmeter and using small wattage bulbs at first.

Tapped mains resistors can be rewound with suitable resistor wire, and very small resistance values can be made by winding D.C.C. wire of suitable resistance on a rather large former where it has to dissipate heat.